



SERVICE BULLETIN

SERVICE BULLETIN NUMBER: 08-25-08-1

DATE ISSUED: Aug 25, 2008

APPLICATION: Fuel Gasculator

SUBJECT: Gasculator Safety wire.

BACKGROUND AND INTRODUCTION:

Powrachute, LLC just recently received notification of a Gasculator lower plug coming loose due to vibration. This will cause the fuel to drain out of the Gasculator bowl and starve the engine of fuel.

RECOMMENDATIONS:

Make sure Bowl and all three plugs are tight.


Drill 1/16" hole in the 1/4" stem part of the plugs. Safety wire the two top vent plugs to each other (See picture #1 below).

Drill 1/16" hole in the 1/4" stem part of the bottom plug. Safety wire the bottom plug to the safety wire connecting the two top plugs. (See picture #2 below)

If you have any questions or need larger pictures please contact Powrachute with the contact information below.



#1

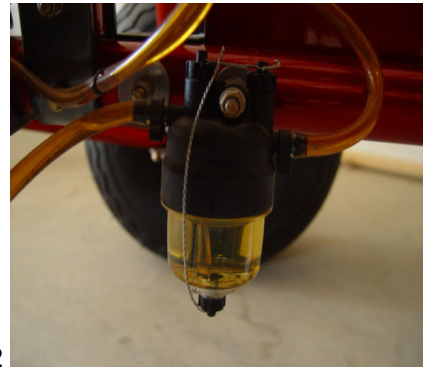

#2

Powrachute Corp.

9425 Spring Creek Ct

Middleville, MI 49333

Ph 574-286-9670

Fax 269-467-9574

Email info@powrachute.com

Web www.powrachute.com